Accessories and Tools

770-031 Right Angle Heat Shrink Boot

Product Series and Basic Number	Angular Function	Material	Boot Size	Adhesive
770-031	A = 90°	1 (Table III)	02 (Table I)	W1 (See Table II; All Boots are Adhesive Lined (Standard is W1))

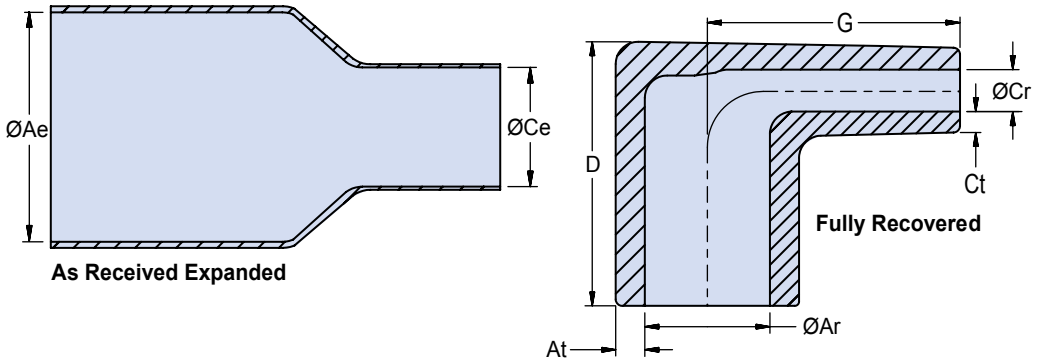


TABLE I: Boot Size and Shrink Boot Dimensions

Boot Size	Glenair US Part Marking (Engraved on Boot)	Ae Min Dia	Ar Max Dia	At ± 10%	Ce Min Dia	Cr Max Dia	Ct ± 10%	G ± 10%	D ± 10%
01	SF1A	.370 (9.40)	.160 (4.06)	.040 (1.02)	.180 (4.57)	.045 (1.14)	.030 (0.76)	.300 (7.62)	.380 (9.65)
02	SF2A	.370 (9.40)	.200 (5.08)	.045 (1.14)	.180 (4.57)	.065 (1.65)	.031 (0.79)	.375 (9.53)	.395 (10.0)
03	SF3A	.560 (14.2)	.260 (6.60)	.050 (1.27)	.370 (9.40)	.095 (2.41)	.035 (0.89)	.440 (11.20)	.469 (11.9)


TABLE II: Glenair Series 77 Boots Adhesive Types

Attribute	W1 Standard High Temperature Hot Melt Adhesive	W2 Hot Melt Adhesive	R High Performance Epoxy Adhesive
Boot Material Compatibility	Type 1, 2, 5, 6 and 7	Type 1, 2, 3 and 7	Type 1, 2, 5 and 6
Continuous Operating Temp.	-55° to +125°C	-40° to +80°C	-75° to +150°C
Resistance to Fuels, Oils & Fluids	Good	Good	Excellent
Low Toxicity, Zero Halogen	Yes	Yes	Yes

TABLE III: Shrink Boot Materials

No.	Compound	Material Description
1	2025	High Performance Elastomer*
2	2010	Zero Halogen Polyolefin*

* Other Materials available

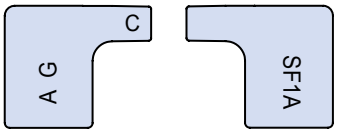

Boots are marked with manufacturer's identification and part number

E

© 2015 Glenair, Inc • 1211 Air Way, Glendale, CA 91201 • 818-247-6000 • www.glenair.com • U.S. CAGE code 06324 • Series 88 SuperFly® Catalog
Dimensions in Inches (millimeters) are subject to change without notice.

Downloaded from Arrow.com.