

■ Accessories (Sold Separately)

(unit: mm)

Dust Covers For XM3B/D/F Sockets
With retaining ring
XM2T-0901 (9 contacts)
XM2T-1501 (15 contacts)
XM2T-2501 (25 contacts)
XM2T-3701 (37 contacts)

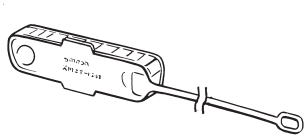

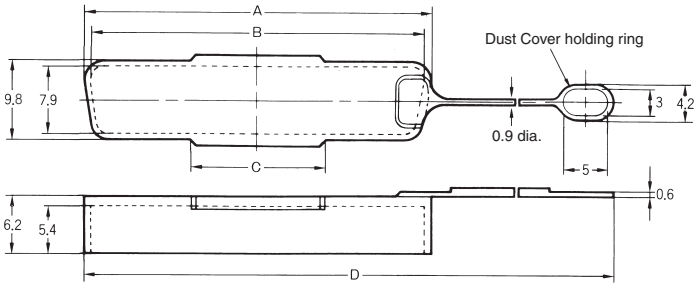

Ratings and Specifications


Operating temperature	– 25 to 85°C (with no condensation or icing)
Material	PA


Dimensions

No. of contacts	Dimensions			
	A	B	C	D
9	17.7	16.3	8	68
15	26.1	24.7	10	77
25	39.8	38.4	15	120
37	56.2	54.8	18	135

Model
XM2T-0901
XM2T-1501
XM2T-2501
XM2T-3701

Dust Covers For XM3B/D/F Sockets
Without retaining ring
XM2T-0901-0 (9 contacts)
XM2T-1501-0 (15 contacts)
XM2T-2501-0 (25 contacts)
XM2T-3701-0 (37 contacts)



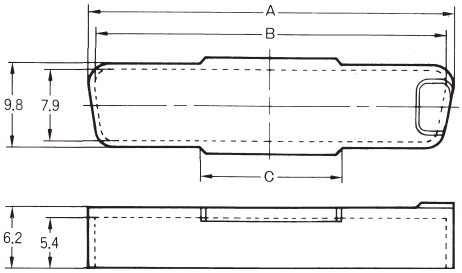


Dimensions

No. of contacts	Dimensions		
	A	B	C
9	17.7	16.3	8
15	26.1	24.7	10
25	39.8	38.4	15
37	56.2	54.8	18


Model
XM2T-0901-0
XM2T-1501-0
XM2T-2701-0
XM2T-3701-0

Downloaded from Arrow.com.

Anchor 1 (Rectangular)
XM2Z-0001
(M2.6 × 0.45 metric screws)
XM2Z-0002
(M3.0 × 0.5 metric screws)
XM2Z-0003
(#4-40 UNC inch screws)

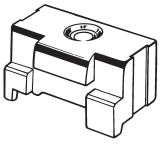


Materials and Finish
Zinc die-cast/nickel plated

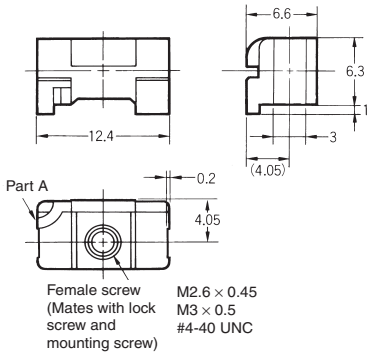


Note: If you use a Dust Cover with a holding ring, secure the holding ring at part A.

Model
XM2Z-0001
XM2Z-0002
XM2Z-0003

Anchor 2 (Hexagonal)
XM2Z-0011
(M2.6 × 0.45 metric screws)
XM2Z-0012
(M3.0 × 0.5 metric screws)
XM2Z-0013
(#4-40 UNC inch screws)

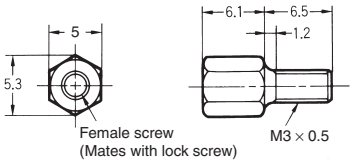





Materials and Finish
Iron/nickel plated

Model
XM2Z-0011
XM2Z-0012
XM2Z-0013

Anchor 3 (Hexagonal)
XM2Z-0021
(M2.6 × 0.45 metric screws)
XM2Z-0022
(M3.0 × 0.5 metric screws)
XM2Z-0023
(#4-40 UNC inch screws)

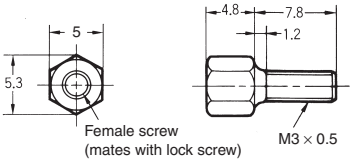



Materials and Finish
Iron/nickel plated


Model
XM2Z-0021
XM2Z-0022
XM2Z-0023

Note: Anchor 3 is used for panel mounting Connectors. Applicable panel thickness is 0.6 to 1.3 mm.


Note: 1. 2 anchors are necessary per connector.
2. Attachment to the XM3K/L is not possible.

Downloaded from Arrow.com.

Grounding Fixtures for XM3B
Tap Hole Grounding Fixtures
XM2Z-0061
(With fixed-side tap holes)

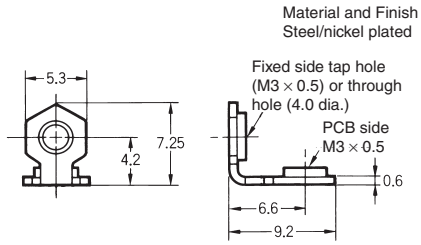


Lock Pin Grounding Fixtures (for XM3B)
XM2Z-0062
(With fixed-side tap holes)
XM2Z-0064
(With fixed-side through holes)

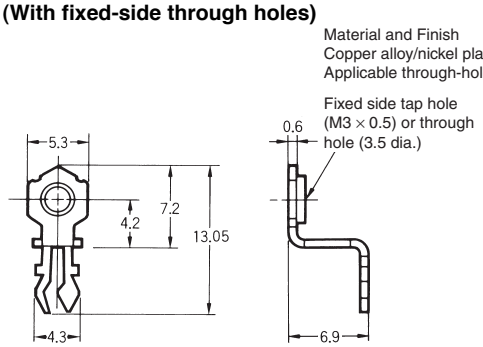

Model
XM2Z-0061
XM2Z-0062
XM2Z-0064


Anchors and Grounding Fixtures

Anchor 2 and 3




Note: Use Grounding Fixtures XM2Z-0061 or XM2Z-0062.

Anchor 1

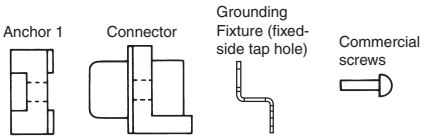

Note: 1. Use a 6-mm screw that mates with the male screw on Anchor 1.
2. Use Grounding Fixtures XM2Z-0064.

Without Anchor

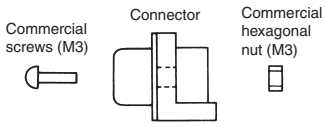

Note: Always use a screw without an Anchor. A Grounding Fixture (fixed-side tap) can be used in place of the hexagonal nut.

Note: 1. Anchor 2 and the following Grounding Fixtures are available: XM3B-□□22-11 and XM3B-□□22-112. Contact your OMRON representative for other anchor and grounding fixture specifications.
2. 2 anchors are necessary per connector.

Downloaded from Arrow.com.

Please check each region's Terms & Conditions by region website.

OMRON Corporation

Electronic and Mechanical Components Company

Regional Contact

Americas
https://www.components.omron.com/

Europe
http://components.omron.eu/

Asia-Pacific
https://ecb.omron.com.sg/

China
https://www.ecb.omron.com.cn/

Korea
https://www.omron-ecb.co.kr/

Japan
https://www.omron.co.jp/ecb/

© OMRON Corporation 2021 All Rights Reserved.
In the interest of product improvement, specifications are subject to change without notice.

Cat. No. G151-E1-01
0721(0721)

Downloaded from Arrow.com.