





## XDM3041 Bench-type Digital Multimeter

- + 4 inch 480 x 320 pixels high resolution LCD
- + resolutions up to 4 1/2 digits
- + reading rates up to 150 readings/s
- + true RMS AC voltage / current measurement
- + dual line display supported
- + the change trend analysis accessible via special chart mode

### Data-logger Mode

during recording the measurement value, possible to set the logging duration (min. 5ms), and length, then get access to chart or table result

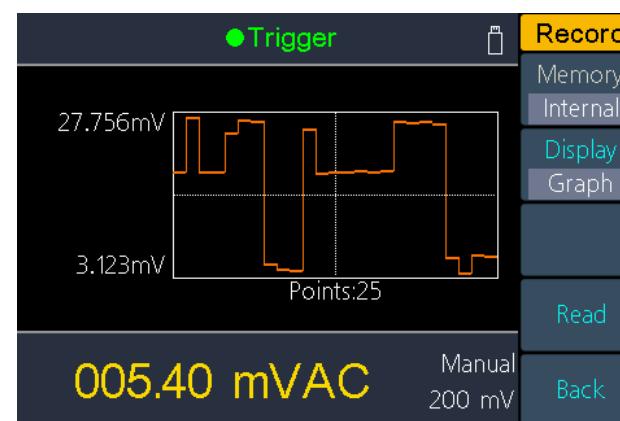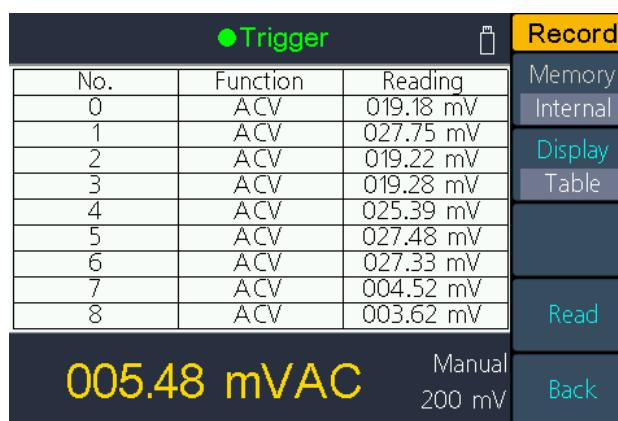

### + Performance Specifications

XDM3041	Measurement Range	Frequency Range	Accuracy: 1 Year ± (% of reading + % of range)
<b>DC Voltage</b>	600mV, 6V, 60V, 600V, 1000V	/	0.02±0.01
<b>True RMS AC Voltage</b>	600mV, 6V, 60V, 600V, 750V	20 Hz - 50 Hz	2 + 0.10
		50 Hz - 20 kHz	0.2 + 0.06
		20 kHz - 50 kHz	1.0 + 0.05
		50 kHz - 100 kHz	3.0 + 0.08
<b>DC Current</b>	600.00 $\mu$ A	/	0.06 + 0.02
	6.0000 mA		0.06 + 0.02
	60.000 mA		0.1 + 0.05
	600.00 mA	/	0.2 + 0.02
	6.000 A		0.2 + 0.05
	10.0000 A		0.250 + 0.05
<b>True RMS AC Current</b>	60.000 mA, 600.00 mA, 6.0000 A, 10.000 A	20 Hz - 45 Hz	2 + 0.10
		45 Hz - 2 kHz	0.50 + 0.10
		2 kHz - 10 kHz	2.50 + 0.20
		/	
<b>Resistance</b>	600.00 $\Omega$	/	0.040 + 0.01
	6.0000 k $\Omega$		0.030 + 0.01
	60.000 k $\Omega$		0.030 + 0.01
	600.00 k $\Omega$	/	0.040 + 0.01
	6.0000 M $\Omega$		0.120 + 0.03

	60.000 MΩ		0.90 + 0.03
	100.00 MΩ		1.75 + 0.03
<b>Diode Test</b>	3.0000 V	/	0.5 + 0.01
<b>Continuity</b>	1000 Ω	/	0.5 + 0.01
		20 Hz - 2 kHz	0.01 + 0.003
		2 kHz - 20 kHz	0.01 + 0.003
<b>Frequency</b>	200 mV - 750 V	20 kHz - 200 kHz	0.01 + 0.003
		200 kHz - 1 MHz	0.01 + 0.006
<b>Period</b>		20 Hz - 2 kHz	0.01 + 0.003
		2 kHz - 10 kHz	0.01 + 0.003
			<b>Test Current</b>
	2.000 nF	200 nA	3 + 1.0
	20.00 nF	200 nA	1 + 0.5
<b>Capacitance</b>	200.0 nF	2 μA	1 + 0.5
	2.000 μF	10 μA	1 + 0.5
	200 μF	100 μA	1 + 0.5
	10000 μF	1 mA	2 + 0.5
			temperature sensors under 2 categories supported -
<b>Temperature</b>			thermocouple (ITS-90 conversion between B / E / J / K / N / R / S / T type), and thermal resistance (RTD sensor conversion between Pt100 and Pt385 type)
<b>Other functions</b>			Bar meter, histogram, trend chart, Max. Min. value, average value, standard deviation, DB / DBm, Pass / Fail

**Data-logger Function****Logging Duration**

5ms

**Logging Length**

1M points

**General****Dimension (W x H x D)**

235 x 110 x 295 (mm)


**Weight (without package)**

3.0 kg

Specifications subject to change without prior notice.

**Accessories** The accessories subject to final delivery.


Power Cord

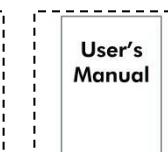


Manual




USB

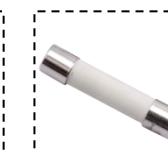

Fuse

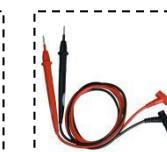

Multimeter Lead

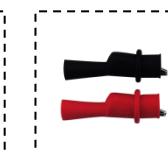

Alligator Clip