Thermofit Molded Parts Specification Control Drawing Limited Distribution


Part Number : 462A42X-X-01

Description : Slimline Transition, 4 Entry

NOTES

1. All dimensions are in $\frac{\text{incnes}}{[\text{millimeters}]}$

- 2. Dimensions appearing in table are as follows:
 - a As Supplied
 - b After Unrestricted Recovery
- Coating is optional. As supplied dimensions appearing in table are for uncoated parts. When coating is added, entry diameters will be reduced by .06 max.

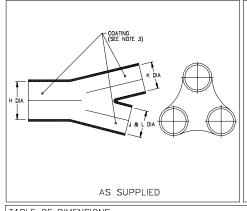

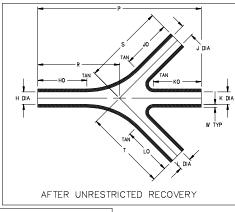


TABLE OF DIMENSIONS											
PART NUMBER	Н		J,K & L		но,јо,ко & Lo	W	Р	R,S & T			
	Min	Max	Min	Max	±15%	Nom	Nom	Nom			
	a	ь	a	ь	b	b	b	b			
462A423-X-01	2.37 [60,2]	.79 [20,1]	1.42 [36,1]	.79 [20,1]	1.09 [27,6]	.06 [1,5]	5 <u>.34</u> [135,6]	2.67 [67,8]			
462A424-X-01	3.93 [99,8]	1.31 [33,3]	2.16 [54,9]	1.31 [33,3]	1.78 [45,2]	.07 [1,8]	8 <u>.16</u> [207,2]	4.08 [103,6]			

If this document is printed it becomes uncontrolled. Check for the latest revision.

Raychem

RAYCHEM CORPORATION 300 CONSTITUTION DRIVE MENLO PARK, CALIFORNIA 94025

Revision : K

Part Number :

462A42X-X-01

Date: 6/9/99


Description: Slimline Transition, 4 Entry

Thermofit Molded Parts Specification Control Drawing Limited Distribution

Part Number : 462A42X-X-01

Description: Slimline Transition, 4 Entry

COMPATABILITY CHART									
MATERIAL DASH NO.	MATERIAL DESCRIPTION	RT SPEC	COATING SLASH NO.	COATING S NO.	COATING DESCRIPTION				
-50	Flexible, VPB	RT-1313							
-51	Flexible, EPB	RT-1321	/86,/164	S-1048, S-1124	Adhesive				
-71	Flexible, Polyolefin	RT-1316	/42	S-1017	Adhesive				

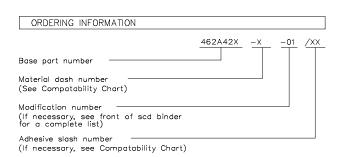

THIS DRAWING IS SUBJECT TO CHANGE WITHOUT NOTICE; CONSULT YOUR NEAREST FIELD REPRESENTATIVE FOR CURRENT REVISION

Raychem

RAYCHEM CORPORATION 300 CONSTITUTION DRIVE MENLO PARK, CALIFORNIA 94025

Revision: K Date: 6/9/99 Part Number : 462A42X-X-01

Description :

Slimline Transition, 4 Entry

CAD FILE MP99111