# DLHR Series Low Voltage Digital Pressure Sensors



**General Description** 

#### **Features**

- 0.5 to 60 in H2O Pressure Ranges
- 1.68V to 3.6V Supply Voltage Range
- I2C or SPI Interface (Automatically Selected)
- Better than 0.25% Accuracy
- High Resolution 16/17/18 bit Output

### **Applications**

- Medical Breathing
- Environmental Controls
- HVAC
- Industrial Controls
- Portable/Hand-Held Equipment

The DLHR Series Mini Digital Output Sensor is based on All Sensors' CoBeam<sup>2TM</sup> Technology. This reduces package stress susceptibility, resulting in improved overall long term stability and vastly improves the position sensitivity.

The digital interface eases integration of the sensors into a wide range of process control and measurement systems, allowing direct connection to serial communications channels. For battery-powered systems, the sensors can enter very low-power mode between readings to minimize load on the power supply.

These calibrated and compensated sensors provide accurate, stable output over a wide temperature range. This series is intended for use with non-corrosive, non-ionic working fluids such as air, dry gases and the like. A protective parylene coating is optionally available for moisture/harsh media protection.

	Standard	Equivalent Circuit			
Device	Operating Range	Proof Pressure	Burst Pressure	Nominal Span	Vs
DLHR-F50D	±0.5 inH2O	100 inH2O	300 inH2O	±0.4 * 2 <sup>24</sup> counts	
DLHR-L01D	±1 inH2O	100 inH2O	300 inH2O	±0.4 * 2 <sup>24</sup> counts	SCLSCL
DLHR-L02D	±2 inH2O	100 inH2O	300 inH2O	±0.4 * 2 <sup>24</sup> counts	I2C ——SDA
DLHR-L05D	±5 inH2O	200 inH2O	300 inH2O	±0.4 * 2 <sup>24</sup> counts	——EOC
DLHR-L10D	±10 inH2O	200 inH2O	300 inH2O	±0.4 * 2 <sup>24</sup> counts	
DLHR-L20D	±20 inH2O	200 inH2O	500 inH2O	±0.4 * 2 <sup>24</sup> counts	Gnd
DLHR-L30D	±30 inH2O	200 inH2O	500 inH2O	±0.4 * 2 <sup>24</sup> counts	
DLHR-L60D	±60 inH2O	200 inH2O	800 inH2O	±0.4 * 2 <sup>24</sup> counts	- OR -
DLHR-L01G	0 to 1 inH2O	100 inH2O	300 inH2O	0.8 * 2 <sup>24</sup> counts	
DLHR-L02G	0 to 2 inH2O	100 inH2O	300 inH2O	0.8 * 2 <sup>24</sup> counts	Vs
DLHR-L05G	0 to 5 inH2O	200 inH2O	300 inH2O	0.8 * 2 <sup>24</sup> counts	——SCLK
DLHR-L10G	0 to 10 inH2O	200 inH2O	300 inH2O	0.8 * 2 <sup>24</sup> counts	——MISO
DLHR-L20G	0 to 20 inH2O	200 inH2O	500 inH2O	0.8 * 2 <sup>24</sup> counts	SPI — MOSI
DLHR-L30G	0 to 30 inH2O	200 inH2O	500 inH2O	0.8 * 2 <sup>24</sup> counts	——/SS ——EOC
DLHR-L60G	0 to 60 inH2O	200 inH2O	800 inH2O	0.8 * 2 <sup>24</sup> counts	
					Gnd

Pressure Sensor Maximum	Ratings	Environmental Specifications			
Supply Voltage (Vs)	3.63 Vdc	Temperature Ranges			
Common Mode Pressure	10 psig	Compensated:	Commercial Industrial	0°C to 70°C -20°C to 85°C	
Lead Temperature (soldering 2-4 sec.)	270 °C	Operating		-25°C to 85 °C	
		Storage		-40°C to 125 °C	
		Humidity Limits (non	condensing)	0 to 95% RH	

ALL SENSORS

DS-0350 REV B

SENSORS

E www.allsensors.com

4 16035 Vineyard Blvd. Morgan Hill, CA 95037

# Performance Characteristics for DLHR Series - Commercial and Industrial Temperature Range

ALL PARAMETERS ARE MEASURED AT  $3.3V \pm 5\%$  excitation and 25C unless otherwise specified (Note 9). Pressure measurements are with positive pressure applied to PORT B.

Parameter	Min	Тур	Max	Units	Notes
Output Span (FSS)					1
LxxD, FxxD LxxG	-	±0.4 * 2 <sup>24</sup> 0.8 * 2 <sup>24</sup>	-	Dec Count Dec Count	
Offset Output @ Zero Diff. Pressure (OSdig)					-
LxxD, FxxD LxxG	-	0.5 * 2 <sup>24</sup> 0.1 * 2 <sup>24</sup>	-	Dec Count Dec Count	
Total Error Band					2
F50D L01x L02x L05x L10x, L20x, L30x, L60x	- - - -	0.35 0.25 0.25 0.20 0.15	1.5 1.0 0.75 0.75 0.75	%FSS %FSS %FSS %FSS %FSS	
Span Temperature Shift					3
F50x, L01x, L02x L05x, L10x, L20x, L30x, L60x	-	±0.5 ±0.2	-	%FSS %FSS	
Offset Temperature Shift					3
F50x, L01x, L02x L05x, L10x, L20x, L30x, L60x	-	±0.5 ±0.2	-	%FSS %FSS	
Offset Warm-up Shift					4
F50x, L01x, L02x L05x, L10x, L20x, L30x, L60x	-	±0.25 ±0.15	-	%FSS %FSS	
Offset Position Sensitivity (±1g)					-
F50x, L01x, L02x L05x, L10x, L20x, L30x, L60x	-	±0.10 ±0.05	-	%FSS %FSS	
Offset Long Term Drift (One Year)					-
F50x, L01x, L02x L05x, L10x, L20x, L30x, L60x	-	±0.25 ±0.15	-	%FSS %FSS	
Linearity, Hysteresis Error					6
F50D, LxxD LxxG	- -	±0.25 ±0.10	-	%FSS %FSS	
Pressure Digital Resolution - No Missing Codes 16-bit Option 17-bit Option 18-bit Option	15.7 16.7 17.7	- - -	- - -	bit bit bit	-
Temperature Output					-
Resolution Overall Accuracy	-	16 2	-	bit °C	
Supply Current Requirement					5, 7, 8
During Active State (ICC <sub>Active</sub> ) During Idle State (ICC <sub>Idle</sub> )	-	2.0 100	2.6 250	mA nA	-
Power On Delay	-	-	2.5	ms	5
Data Update Time (t <sub>DU</sub> )		(see table below)		ms	5, 7

		Measurement Command											
Calibrated Resolution	Single		Average2		Average4		Average8		Average16		Units		
Resolution	Тур	Max	Тур	Max	Тур	Max	Тур	Max	Тур	Max	Onits		
16 bit option	2.80	3.1	5.40	6.0	10.60	11.7	21.00	23.2	41.80	46.0	ms		
17 bit option	3.20	3.6	6.20	6.9	12.20	13.5	24.20	26.7	48.20	53.1	ms		
18 bit option	3.70	4.1	7.20	8.0	14.20	15.7	28.20	31.1	56.20	61.9	ms		

Downloaded from Arrow.com.

#### 12C / SPI Electrical Parameters for DLHR Series

Parameter	Symbol	Min	Тур	Max	Units	Notes
Input High Level	-	80.0	-	100	% of Vs	5
Input Low Level	-	0	-	20.0	% of Vs	5
Output Low Level	-	-	-	10.0	% of Vs	5
I2C Pull-up Resistor	-	1000	-	-	Ω	5
I2C Load Capacitance on SDA, @ 400 kHz	Csda	-	-	200	pF	5
I2C Input Capacitance (each pin)	C <sub>12</sub> C_IN	-	-	10.0	pF	5
I2C Address			41		decimal	

# **Pressure Output Transfer Function**

$$Pressure(inH_2O) = 1.25 \times \left(\frac{Pout_{dig} - OS_{dig}}{2^{24}}\right) \times FSS(inH_2O)$$

Where:

Pout<sub>dig</sub> Is the sensor 24-bit digital output.

 $OS_{dig}$ Is the specified digital offset

 $0.1 * 2^{24}$ For Gage Operating Range sensors:  $0.5 * 2^{24}$ For Differential Operating Range sensors:

 $FSS(inH_2O)$ The sensor Full Scale Span in inches H<sub>2</sub>O

For Gage Operating Range sensors: Full Scale Pressure

For Differential Operating Range sensors: 2 x Full Scale Pressure.

# **Temperature Output Transfer Function**

$$Temperature~(^{\circ}\mathrm{C}) = \left(\frac{Tout_{dig}*~125}{2^{24}}\right) - 40$$

Where:

 $Tout_{dia}$ The sensor 24-bit digital temperature output.

(Note that only the upper 16 bits are significant)

#### Specification Notes

NOTE 1: THE SPAN IS THE ALGEBRAIC DIFFERENCE BETWEEN FULL SCALE DECIMAL COUNTS AND THE OFFSET DECIMAL COUNTS.

NOTE 2: TOTAL ERROR BAND CONSISTS OF OFFSET AND SPAN TEMPERATURE AND CALIBRATION ERRORS, LINEARITY AND PRESSURE HYSTERESIS ERRORS, OFFSET WARM-UP SHIFT OFFSET POSITION SENSITIVITY AND LONG TERM OFFSET DRIFT FRRORS

NOTE 3: SHIFT IS RELATIVE TO 25C.

NOTE 4: SHIFT IS WITHIN THE FIRST HOUR OF EXCITATION APPLIED TO THE DEVICE.

PARAMETER IS CHARACTERIZED AND NOT 100% TESTED.

NOTE 6: MEASURED AT ONE-HALF FULL SCALE RATED PRESSURE USING BEST STRAIGHT LINE CURVE FIT.

NOTE 7: DATA UPDATE TIME IS EXCLUSIVE OF COMMUNICATIONS, FROM COMMAND RECEIVED TO END OF BUSY STATUS. THIS CAN BE OBSERVED AS EOC PIN LOW- STATE DURATION.

NOTE 8: AVERAGE CURRENT CAN BE ESTIMATED AS: ICC Idle + (tDU / READING INTERVAL) \* ICCACTIVE). REFER TO FIGURE 2 FOR ACTIVE AND IDLE CONDITIONS OF THE SENSOR (THE ACTIVE STATE IS WHILE EOC PIN IS LOW).

NOTE 9: THE SENSOR IS CALIBRATED WITH A 3.3V SUPPLY HOWEVER, AN INTERNAL REGULATOR ALLOWS A SUPPLY VOLTAGE OF 1.68V TO 3.6V TO BE USED WITHOUT AFFECTING THE OVERALL SPECIFICATIONS. THIS ALLOWS DIRECT OPERATION FROM A BATTERY SUPPLY.

ALL SENSORS

DS-0350 REV B

SENSORS

E www.allsensors.com

4 16035 Vineyard Blvd. Morgan Hill, CA 95037

#### **Device Ordering Options**

#### **Output Resolution**

Calibrated output resolution can be ordered to be 16, 17, or 18 bits.

Higher resolution results in slower update times; see the Data Update Time in the Performance Characteristics table.


#### Coatino

Parylene Coating: Parylene coating provides a moisture barrier and protection form some harsh media. Consult factory for applicability of Parylene for the target application and sensor type.

#### **Operation Overview**

The DLHR is a digital sensor with a signal path that includes a sensing element, a variable- bit analog to digital converter, a DSP and an IO block that supports either an I2C or SPI interface (see Figure 1 below). The sensor also includes an internal temperature reference and associated control logic to support the configured operating mode. Since there is a single ADC, there is also a multiplexer at the front end of the ADC that selects the signal source for the ADC.

Figure 1 - DLHR Essential Model

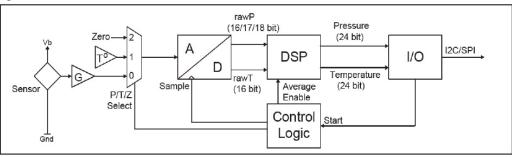

The ADC performs conversions on the raw sensor signal (P), the temperature reference (T) and a zero reference (Z) during the ADC measurement cycle.

The DSP receives the converted pressure and temperature information and applies a multi-order transfer function to compensate the pressure output. This transfer function includes compensation for span, offset, temperature effects on span, temperature effects on offset and second order temperature effects on both span and offset. There is also linearity compensation for gage devices and front to back linearity compensation for differential devices.

<u>Sensor Commands</u>: Five Measurement commands are supported, returning values of either a single pressure / temperature reading or an average of 2, 4, 8, or 16 readings. Each of these commands wakes the sensor from Idle state into Active state, and starts a measurement cycle. For the Start-Average commands, this cycle is repeated the appropriate numper of times, while the Start-Single command performs a single iteration. When the DSP has completed calculations and the new values have been made available to the I/O block, the sensor returns to Idle state. The sensor remains in this low-power state until another Measurement command is received.

After completion of the measurement, the result may then be read using the Data Read command. The ADC and DSP remain in Idle state, and the I/O block returns the 7 bytes of status and measurement data. See Figure 2, following. At any time, the host may request current device status with the Status Read command.

See Table 1 for a summary of all commands.

For optimum sensor performance, All Sensors recommends that Measurement commands be issued at a fixed interval by the host system. Irregular request intervals may increase overall noise on the output.

Furthermore, if reading intervals are much slower than the Device Update Time, using the Averaging commands is suggested to reduce offset shift. This shift is constant with respect to time interval, and may be removed by the application. For longer fixed reading intervals, this shift may be removed by the factory on special request.

<u>I/O Interface Configuration:</u> The sensor automatically selects SPI or I2C serial interface, based on the following protocol: If the /SS input is set low by the host (as occurs during a SPI command transaction), the I/O interface will remain configured for SPI communications until power is removed. Otherwise, once a valid device address and command have been received over the I2C interface, the I/O interface will remain configured for I2C until power is removed. *NOTE: The four-pin (SIP) packages only support the I2C interface.* 

DLHR Series Low Voltage Digital Pressure Sensors

# Start-Single Command

Command	Start-Single	]		Data Read	Start-Single			
Internal State	Idle	Active		Idle		Active		Idle
Interal Operation	Idle	ADC (Temp, Zero, Pressure)	DSP	Idle		ADC (Temp, Zero, Pressure)	DSP	Idle
New Data Available								
EOC		٦					1	

#### Start-Average2 / 4 / 8 / 16 Commands (Auto Averaging)

•	0 0			
Command	Start-Average2/4/8/16		Data Read Start-Average2/4/8/16	
Internal State	Idle	Active	Idle	Active
Interal Operation	Idle	ADC (Temp, Zero, Pressure), ADC (Temp, Zero, Pressure), DSP	ldle	ADC (T, Z, P)
New Data Available	-			
EOC				1

## **Digital Interface Command Formats**

When requesting the start of a measurement, the command length for I2C is 1 byte, for SPI it is 3 bytes.

When requesting sensor status over I2C, the host simply performs a 1-byte read transfer.

When requesting sensor status over SPI, the host *MUST* send the Status Read command byte while reading 1 byte.

When reading sensor data over I2C, the host simply performs a 7-byte read transfer.

When reading sensor data over SPI, the host **MUST** send the 7-byte Data Read command while reading the data.

**SENDING UNDOCUMENTED COMMANDS TO SENSOR WILL CORRUPT CALIBRATION AND IS NOT COVERED BY WARRANTY.**See Table 1 below for Measurement Commands, Sensor Data read and Sensor Status read details.

Table 1 - DLHR Sensor Command Set

<b>Measurement Commands</b>						
Description	SP	ମ ( 3 byte	I2C ( 1 byte)			
Start-Single	0xAA	0x00	0x00	0xAA		
Start-Average2	0xAC	0x00	0x00	0xAC		
Start-Average4	0xAD	0x00	0x00	0xAD		
Start-Average8	0xAE	0x00	0x00	0xAE		
Start-Average16	0xAF	0x00	0x00	0xAF		

	Read Sensor Data						
I2C	Read of 7 bytes from device						
SPI	Read of 7 bytes from device  Host must send [0xF0], then 6 bytes of [0x00] on MOSI  Sensor Returns 7 bytes on MISO						

Read Sensor Status						
I2C	Read of 1 byte from device.					
CDI	Read of 1 byte from device  Host must send [0xF0] on MOSI					
SPI	Host must send [UXFU] on MOSI					
	Sensor Returns 1 byte on MISO					

DS-0350 REV B

Page 5



SENSORS

E www.allsensors.com

## Digital Interface Data Format

For either type of digital interface, the format of data returned from the sensor is the same. The first byte consists of the Status Byte followed by a 24-bit unsigned pressure value and a 24-bit unsigned temperature value. Unused bits beyond the calibrated bit width are undefined, and may have any value. See the Pressure Output Transfer Function and Temperature Output Transfer Function definitions on page 3 for converting to pressure and temperature. Refer to Table 2 for the overall data format of the sensor. Table 3 shows the Status Byte definition. Note that a completed reading without error will return status 0x40.

Table 2 - Output Data Format

	S[7:0]	P[23:16]	P[15:8]	P[7:0]	T[23:16]	T[15:8]	T[7:0]
ı	Status	Pressure	Pressure	Pressure	Temperature	Temperature	Temperature
ı	Byte	Byte 3	Byte 1	Byte 0	Byte 3	Byte 1	Byte 0

Table 3- Status Byte Definition

Bit	Description
Bit 7 [MSB]	[Always = 0]
6	Power : [1 = Power On]
5	Busy: [1 = Processing Command, 0 = Ready]
	Mode: [00 = Normal Operation ]
2	Memory Error [ 1 = EEPROM Checksum Fail]
1	Sensor Configuration [ always = 0]
Bit 0 [LSB]	ALU Error [1 = Error]

#### **I2C** Interface

#### **I2C Command Sequence**

The part enters Idle state after power-up, and waits for a command from the bus master. Any of the five Measurement commands may be sent, as shown in Table 1. Following receipt of one of these command bytes, the EOC pin is set to Low level, and the sensor Busy bit is set in the Status Byte. After completion of measurement and calculation in the Active state, compensated data is written to the output registers, the EOC pin is set high, and the processing core goes back to Idle state. The host processor can then perform the Data Read operation, which for I2C is simply a 7-byte Device Read.

If the EOC pin is not monitored, the host can poll the Status Byte by repeating the Status Read command, which for I2C is a one-byte Device Read. When the Busy bit in the Status byte is zero, this indicate that valid data is ready, and a full Data Read of all 7 bytes may be performed.

DO NOT SEND COMMANDS TO SENSOR OTHER THAN THOSE DEFINED IN TABLE 1.

#### I2C Interface (Cont'd)

#### **I2C Bus Communications Overview**

The I2C interface uses a set of signal sequences for communication. The following is a description of the supported sequences and their associated mnemonics. Refer to Figure 3 for the associated usage of the following signal sequences.

Bus not Busy (I): During idle periods both data line (SDA) and clock line (SCL) remain HIGH.

START condition (ST): A HIGH to LOW transition of SDA line while the clock (SCL) is HIGH is interpreted as START condition. START conditions are always set by the master. Each initial request for a pressure value has to begin with a START condition.


Slave address (An): The I<sup>2</sup>C-bus requires a unique address for each device. The DLH sensor has a preconfigured slave address (see specification table on Page 3). After setting a START condition the master sends the address byte containing the 7 bit sensor address followed by a data direction bit (R/W). A "0" indicates a transmission from master to slave (WRITE), a "1" indicates a device-to master request (READ).

Acknowledge (A or N): Data is transferred in units of 8 bits (1 byte) at a time, MSB first. Each data-receiving device, whether master or slave, is required to pull the data line LOW to acknowledge receipt of the data. The Master must generate an extra clock pulse for this purpose. If the receiver does not pull the data line down, a NACK condition exists, and the slave transmitter becomes inactive. The master determines whether to send the last command again or to set the STOP condition, ending the transfer.

DATA valid (Dn): State of data line represents valid data when, after a START condition, data line is stable for duration of HIGH period of clock signal. Data on line must be changed during LOW period of clock signal. There is one clock pulse per data bit.

STOP condition (P): LOW to HIGH transition of the SDA line while clock (SCL) is HIGH indicates a STOP condition. STOP conditions are always generated by the master.

Figure 3 - I2C Communication Diagram

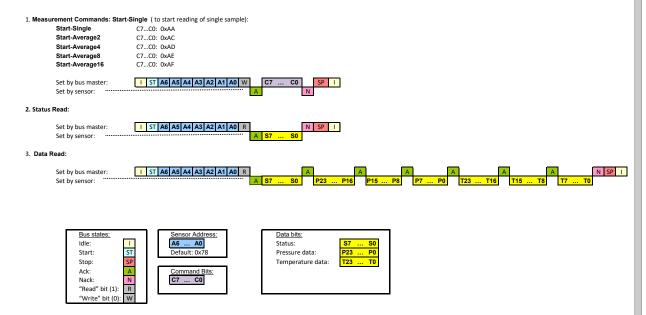

ALL SENSORS

DS-0350 REV B

#### SPI Interface

#### **SPI Command Sequence**

As with the I2C interface configuration, the part enters Idle state after power-up, and waits for a command from the SPI master. To start a measurement cycle, one of the 3- byte Measurement Commands (see Table 1) must be issued by the master. The data returned by the sensor during this command request consists of the Status Byte followed by two undefined data bytes. On successful decode of the command, the EOC pin is set Low as the core goes into Active state for measurement and calculation. When complete, updated sensor data is written to the output registers, and the core goes back to the Idle state. The EOC pin is set to a High level at this point, and the Busy status bit is set to 0. At any point during the Active or Idle periods, the SPI master can request the Status Byte by sending a Status Read command (a single byte with value 0xF0).


As with the I2C configuration, a Busy bit of value 0 in the Status Byte or a high level on the EOC pin indicates that a valid data set may be read from the sensor. The Data Read command must be sent from the SPI master (The first byte of value 0xF0 followed by 6 bytes of 0x00).


**NOTE:** Sending commands that are not defined in Table 1 will corrupt sensor operation.

#### **SPI Bus Communications Overview**

The sequence of bits and bus signals are shown in the following illustration (Figure 4). Refer to Figure 5 in the Interface Timing Diagram section for detailed timing data.

Figure 4 - SPI Communications Diagram

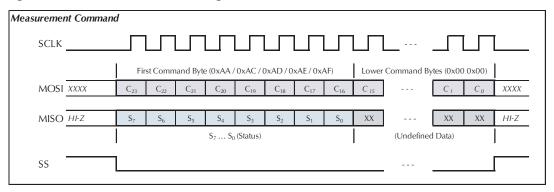

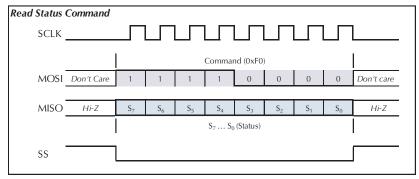


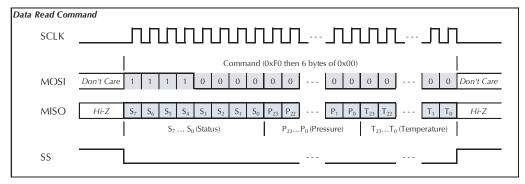



Figure 5 - SPI Timing Diagram

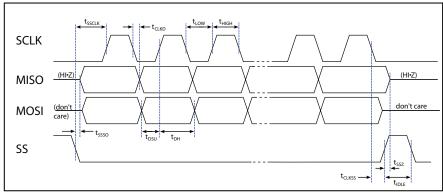

PARAMETER	SYMBOL	MIN	TYP	MAX	UNITS
SCLK frequency (1)	fsclk	0.05	-	5	MHz
SS low to first clock edge	tssclk	120	-	-	ns
SS low to serial out	tssso			20	ns
Clock to data out	tclkd	8	1	32	ns
SCLK low width	tlow	100	1	-	ns
SCLK high width	thigh	100		-	ns
Data setup to clock	tdsu	50	-	-	ns
Data hold after clock	tdH	50		-	ns
Last clock to rising SS	tclkss	0	1	-	ns
SS high to output hi-Z	tssz	-	-	20	ns
Bus idle time	tidle	250	-	-	ns

<sup>(1)</sup> Maximum by design, tested to 1.0 MHz.

Figure 6 - I2C Timing Diagram

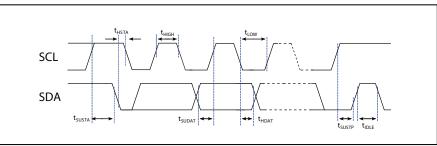

PARAMETER	SYMBOL	MIN	TYP	MAX	UNITS
SCL frequency	fscl	100	-	400	KHz
SCL low width	tlow	1.3	-	-	us
SCL high width	thigh	0.6	-	-	us
Start condition setup	tsusta	0.6	-	-	us
Start condition hold	thsta	0.6	-	-	us
Data setup to clock	tsudat	0.1	-	-	us
Data hold to clock	thdat	0	-	-	us
Stop condition setup	tsustp	0.6	-	-	us
Bus idle time	fini e	2.0	-	-	LIS

SENSORS

E www.allsensors.com

A 16035 Vineyard Blvd. Morgan Hill, CA 95037

#### How to Order

Refer to Table 4 for configuring a standard base part number which includes the pressure range, package and temperature range. Table 5 shows the available configuring options. The option identifier is required to complete the device part number. Refer to Table 6 for the available device packages.

Example P/N with options: DLHR-L02D-E1NS-C-NAV6

Table 4 - How to configure a base part

	SERIES	PRESS	SURE RANGE				TEMPERATURE RANGE					
				Base		Port Orientation		Lid Style		Lead Type		
	ID	ID	Description	ID	ID	Description	ID	Description	ID	Description	ID	Description
	DLHR	F50D	±0.5 inH2O	E	1	Dual Port Same Side	N	Non-Barbed	S	SIP	С	Commercial
_		L01D	±1 inH2O		2	Dual Port Opposite Side	В	Barbed	D	DIP	- 1	Industrial
NO		L02D	±2 inH2O						J	J-Lead SMT		
AT		L05D	±5 inH2O									
ORDERING INFORMATION		L10D	±10 inH2O									
요		L20D	±20 inH2O									
€ (5		L30D	±30 inH2O									
ž		L60D	±60 inH2O									
JER.		L01G	0 to 1 inH2O									
ORI		L02G	0 to 2 inH2O									
		L05G	0 to 5 inH2O									
		L10G	0 to 10 inH2O									
		L20G	0 to 20 inH2O									
		L30G	0 to 30 inH2O									
		L60G	0 to 60 inH2O									
Example	DLHR	- L02D		E	1		N		S		- <b>C</b>	

Table 5 - How to configure an option identifier

ORDERING INFORMATION		COATING		INTERFACE	SL	JPPLY VOLTAGE	RESOLUTION		
	ID	ID Description		Description	ID	Description	ID	Description	
	N	No Coating	Α	Auto I2C/SPI	V	1.68V to 3.6V	6	16 Bit	
	Р	Parylene Coating (1)					7	17 bit	
							8	18 bit	
Example	N		Α		٧		6		

<sup>(1)</sup> Parylene coating not offered on J-Lead Configurations


Table 6 - Available E-Series Package Configurations


Port			rbed Lid Style		Barbed Lid Lead Style					
Orientation	SIP (1)	DIP	J Lead SMT	Low Profile DIP	SIP (1)	DIP	J Lead SMT	Low Profile DIP		
Dual Port Same Side				N/A			N/A	N/A		
	E1NS	E1ND	E1NJ		E1BS	E1BD				
Dual Port Opposite Side				N/A			N/A	N/A		
	E2NS	E2ND	E2NJ		E2BS	E2BD				
Single Port (Gage)	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A		

<sup>(1)</sup> SPI is not available in SIP packages

Downloaded from Arrow.com.

# Package Drawings

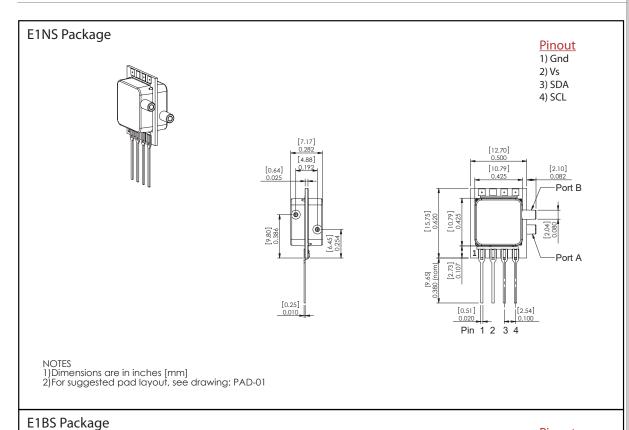

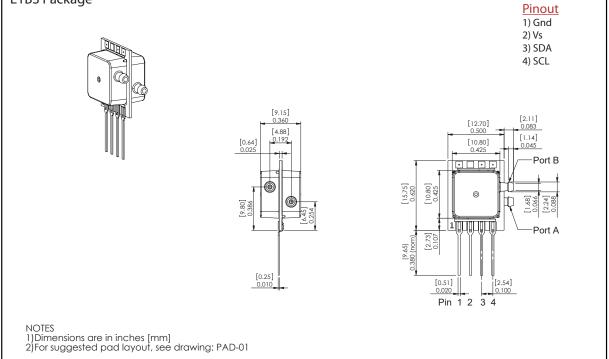

ALL SENSORS


DS-0350 REV B


SENSORS

ALL


E www.allsensors.com


A 16035 Vineyard Blvd. Morgan Hill, CA 95037

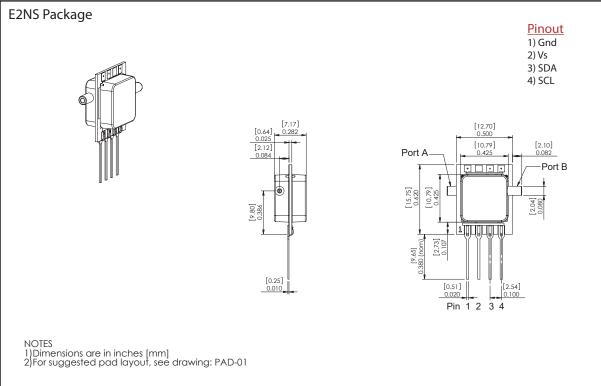

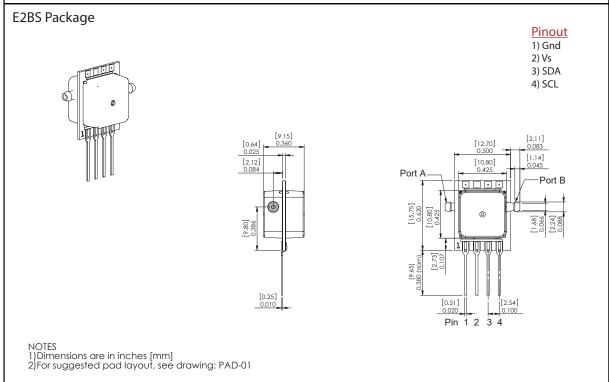

# Package Drawings (Cont'd)

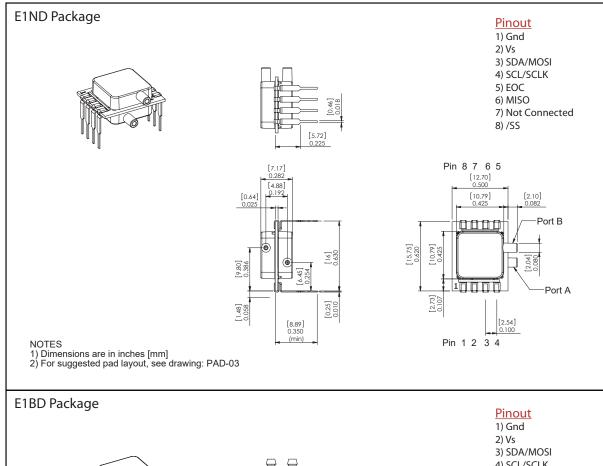

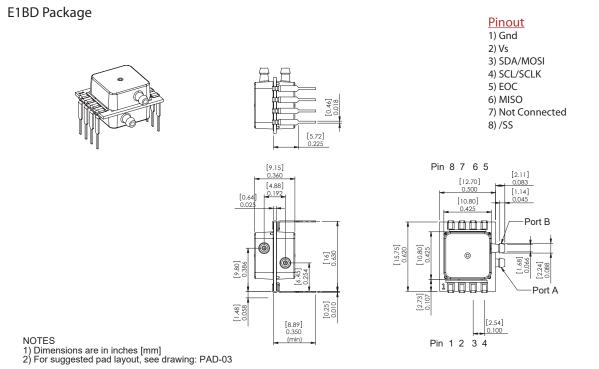

ALL SENSORS

DS-0350 REV B


SENSORS

ALL

E www.allsensors.com

A 16035 Vineyard Blvd. Morgan Hill, CA 95037

# Package Drawings (Cont'd)

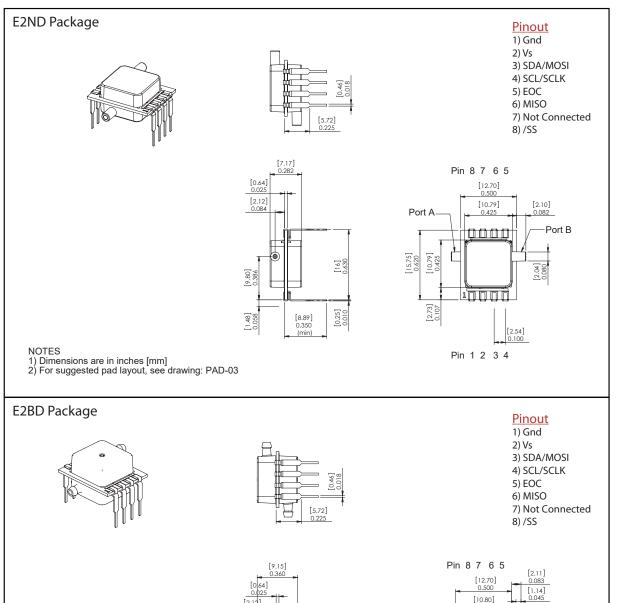



## DLHR Series Low Voltage Digital Pressure Sensors

Port A

[15.75]

[9]

[1.48]

17777

Pin 1 2 3 4


[2.54] 0.100

# Package Drawings (Cont'd)

# E1NJ Package







**SCALE 4:1** 

# 1)Dimensions are in inches [mm] 2)For suggested pad layout, see drawing: PAD-10

#### **Pinout**

- 1) Gnd
- 2) Vs 3) SDA/MOSI
- 4) SCL/SCLK
- 5) EOC
- 6) MISO

Pinout 1) Gnd

2) Vs 3) SDA/MOSI 4) SCL/SCLK

5) EOC 6) MISO 7) Not Connected

8) /SS


7) Not Connected

SENSORS

ALL

E www.allsensors.com

8) /SS

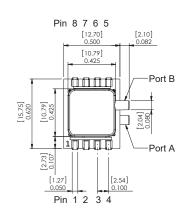



# E2NJ Package






DETAIL A SCALE 4 : 1





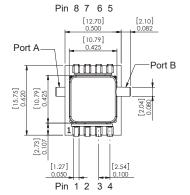

NOTES 1)Dimensions are in inches [mm] 2)For suggested pad layout, see drawing: PAD-10


ALL SENSORS


**DS-0350 REV B** 







### Suggested Pad Layout

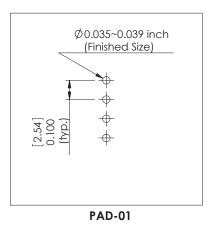

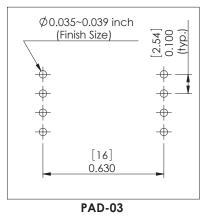

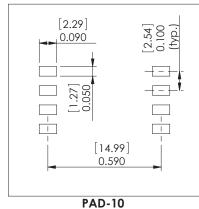

# **Product Labeling**

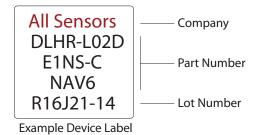

All Sensors reserves the right to make changes to any products herein. All Sensors does not assume any liability arising out of the application or use of any product or circuit described herein, neither does it convey any license under its patent rights nor the rights of others.